

YOUR ONESURVEY
HOME REPORT

ADDRESS

1 Ben Wyvis View
Barn Church Road
Culloden
Inverness, IV2 7WB

PREPARED FOR

Andrew Davidson

INSPECTION CARRIED OUT BY:



SELLING AGENT:



HOME REPORT GENERATED BY:



Document Index

Document	Status	Prepared By	Prepared On
Single Survey	Final	Inverness - Allied Surveyors Scotland Ltd	13/09/2024
Mortgage Certificate	Final	Inverness - Allied Surveyors Scotland Ltd	13/09/2024
Property Questionnaire	Final	Mr. Andrew Davidson	
EPC	Final	Inverness - Allied Surveyors Scotland Ltd	13/09/2024
Additional Documents	Final		

Important Notice:

This report has been prepared for the purposes and use of the person named on the report. In order to ensure that you have sight of a current and up to date copy of the Home Report it is **essential** that you log onto www.onesurvey.org (free of charge) to download a copy personalised in your own name. This enables both Onesurvey and the Surveyor to verify that you have indeed had sight of the appropriate copy of the Home Report prior to your purchasing decision. This personalised report can then be presented to your legal and financial advisers to aid in the completion of your transaction. **Failure to obtain a personalised copy may prevent the surveyor having any legal liability to you as they will be unable to determine that you have relied on this report prior to making an offer to purchase.**

Neither the whole, nor any part of this report may be included in any published document, circular or statement, nor published in any way without the consent of Onesurvey Ltd. Only the appointed Chartered Surveyor can utilise the information contained herein for the purposes of providing a transcription report for mortgage/loan purposes.

P A R T 1 .

SINGLE SURVEY

A report on the condition of the property, with categories being rated from 1 to 3.



Single Survey

Survey report on:

Surveyor Reference	I/24/09/029
---------------------------	-------------

Customer	Mr. Andrew Davidson
-----------------	---------------------

Selling address	1 Ben Wyvis View Barn Church Road Culloden Inverness IV2 7WB
------------------------	--

Date of Inspection	11/09/2024
---------------------------	------------

Prepared by	Graham Laird, BSc (Hons) MRICS Inverness - Allied Surveyors Scotland Ltd
--------------------	---

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

¹ Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report. 2

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for

expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and

² Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the “Surveyors” are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the “Surveyors” means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller’s permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor’s opinion, are not

significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an

arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- *There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- *There are no particularly troublesome or unusual legal restrictions;
- *There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

“Re-instatement cost” is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	The subjects comprise a two bedroom ground floor flat in a two-storey block of four units.
Accommodation	The accommodation may be summarised as follows: Entrance Hallway, Lounge, Kitchen, Bathroom, Master Bedroom with En-Suite and One Further Bedroom.
Gross internal floor area (m ²)	60 approximately.
Neighbourhood and location	The property is located between a Chinese Takeaway and Community Centre, on the outskirts of the Smithton district of the city of Inverness. A wide range of amenities and facilities are available in close proximity.
Age	Built circa 2008.
Weather	Cloudy and dry, following a period of mixed weather.
Chimney stacks	There are no chimney stacks.
Roofing including roof space	The roof is of a pitched design, clad with concrete interlocking tiles. Ridges and hips are formed in tile. The building's roof space has not been accessed. <i>Sloping roofs were visually inspected with the aid of binoculars where required.</i>
Rainwater fittings	Gutters and downpipes are of a half round and round design and are formed in uPVC. <i>Visually inspected with the aid of binoculars where required.</i>

Main walls	<p>Main walls are consistent with being of cavity construction with a timber frame inner load bearing leaf and a concrete block work outer leaf, externally rendered. There is provision for sub-floor ventilation at ground level. There are some facing brick finishes.</p> <p>Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected.</p>
Windows, external doors and joinery	<p>Windows are of a double glazed timber casement type.</p> <p>The front door is of a panelled effect flush timber type with a double glazed section.</p> <p>Soffits and fascias are formed in timber.</p> <p>Internal and external doors were opened and closed where keys were available.</p> <p>Random windows were opened and closed where possible.</p> <p>Doors and windows were not forced open.</p>
External decorations	<p>External joinery is finished in wood stain.</p> <p>Visually inspected.</p>
Conservatories / porches	<p>There are no conservatories or porches.</p>
Communal areas	<p>There is a shared parking area which surrounds the block.</p> <p>Boundaries are defined by timber post and panel fencing and concrete block retaining walls.</p> <p>Circulation areas visually inspected.</p>
Garages and permanent outbuildings	<p>There are no garages or permanent outbuildings.</p>
Outside areas and boundaries	<p>See 'Communal areas' section.</p> <p>Visually inspected.</p>
Ceilings	<p>Ceilings are formed in plasterboard.</p> <p>Visually inspected from floor level.</p>
Internal walls	<p>Internal walls are lined with plasterboard. There are some tiled and wet wall finishes.</p> <p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p>
Floors including sub floors	<p>Floors are of suspended timber construction. Sub-floor areas have not been accessed.</p> <p>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</p>

<p>Internal joinery and kitchen fittings</p>	<p>Internal joinery finishes are formed in timber.</p> <p>Internal doors are of a panelled timber type and a glazed timber type. There are some sliding mirrored wardrobe doors.</p> <p>The kitchen is fitted with a range of floor and wall mounted units.</p> <p><i>Built-in cupboards were looked into but no stored items were moved.</i></p> <p><i>Kitchen units were visually inspected excluding appliances.</i></p>
<p>Chimney breasts and fireplaces</p>	<p>There are no chimney breasts or fireplaces.</p>
<p>Internal decorations</p>	<p>Walls and ceilings are painted.</p> <p><i>Visually inspected.</i></p>
<p>Cellars</p>	<p>There are no cellars.</p>
<p>Electricity</p>	<p>Mains supply. Visible wiring is run in PVC coated cabling with 13 amp outlets.</p> <p>The electricity meter and circuit breakers are located in a cupboard in the hallway.</p> <p><i>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances.</i></p> <p><i>Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</i></p>
<p>Gas</p>	<p>Mains supply. The meter is located externally.</p> <p><i>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances.</i></p> <p><i>Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</i></p>

<p>Water, plumbing and bathroom fittings</p>	<p>Mains supply. Visible pipework is formed in copper, uPVC, braided steel and rubber.</p> <p>The bathroom is fitted with a white suite comprising bath with mixer shower fitting over, toilet and wash hand basin.</p> <p>The en-suite is fitted with a white suite comprising mixer shower cubicle, toilet and wash hand basin.</p> <p>There is a stainless steel sink unit fitted in the kitchen.</p> <p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p>
<p>Heating and hot water</p>	<p>There is a Worcester Greenstar 30CDi Combi gas fired combination central heating boiler, located in the kitchen. This is connected to steel panelled radiators distributed throughout the property and also provides domestic hot water.</p> <p>There is electric underfloor heating in the bathroom.</p> <p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p>
<p>Drainage</p>	<p>Drainage is connected to the mains.</p> <p>Drainage covers etc were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p>
<p>Fire, smoke and burglar alarms</p>	<p>There are smoke detectors fitted in the hallway and in the lounge. There is a heat detector fitted in the kitchen.</p> <p>Visually inspected.</p> <p>No test whatsoever were carried out to any systems or appliances.</p> <p>There is now a requirement in place for compliant interlinked fire, smoke and heat detectors in residential properties. The new fire smoke and alarm standard came into force in Scotland in February 2022, requiring a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also requires to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon fuelled appliance such as a boiler, open fire or wood burner etc. a carbon monoxide detector is also required.</p> <p>The surveyor will only comment on the presence of a smoke detector etc. but will not test them, ascertain if they are in working order, interlinked and / or fully compliant with the fire and smoke alarm standard that was introduced in 2022.</p>

<p>Any additional limits to inspection</p>	<p>If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the Surveyor will assume that there are no defects that will have a material effect on the valuation.</p> <p><i>The building containing the flat, including any external communal areas, was visually inspected only to the extent that the Surveyor is able to give an opinion on the general condition and standard of maintenance.</i></p> <p>The property was unfurnished and all floors were covered.</p> <p>Services, electrical circuits, plumbing installation, heating and drainage systems have not been specifically tested.</p> <p>Parts of the property which are covered, unexposed or inaccessible cannot be guaranteed to be free from defect.</p> <p>Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.</p> <p>The building's roof space has not been accessed.</p> <p>Floor coverings have not been moved.</p> <p>Sub-floor areas were not accessed.</p> <p>Areas below the bath and shower tray were not visible.</p> <p>Inspection of the exterior of the building was restricted to areas visible from ground level within the grounds of the subjects and from the public road.</p> <p>An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive.</p>
--	---

Sectional Diagram showing elements of a typical house



- ① Chimney pots
- ② Coping stone
- ③ Chimney head
- ④ Flashing
- ⑤ Ridge ventilation
- ⑥ Ridge board
- ⑦ Slates / tiles
- ⑧ Valley guttering
- ⑨ Dormer projection
- ⑩ Dormer flashing
- ⑪ Dormer cheeks
- ⑫ Sarking
- ⑬ Roof felt
- ⑭ Trusses
- ⑮ Collar
- ⑯ Insulation
- ⑰ Parapet gutter
- ⑱ Eaves guttering
- ⑲ Rainwater downpipe
- ⑳ Verge boards / skewes
- ㉑ Soffit boards
- ㉒ Partiton wall
- ㉓ Lath / plaster
- ㉔ Chimney breast
- ㉕ Window pointing
- ㉖ Window sills
- ㉗ Rendering
- ㉘ Brickwork / pointing
- ㉙ Bay window projection
- ㉚ Lintels
- ㉛ Cavity walls / wall ties
- ㉜ Subfloor ventilator
- ㉝ Damp proof course
- ㉞ Base course
- ㉟ Foundations
- ㊱ Solum
- ㊲ Floor joists
- ㊳ Floorboards
- ㊴ Water tank
- ㊵ Hot water tank

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the above 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category:	1
Notes:	There was no evidence of any serious or ongoing movement noted within the limitations of inspection.

Dampness, rot and infestation	
Repair category:	1
Notes:	There was no evidence of any dampness, rot or infestation.

Chimney stacks	
Repair category:	
Notes:	Not applicable.

Roofing including roof space	
Repair category:	1
Notes:	No significant defects noted.

Rainwater fittings	
Repair category:	1
Notes:	No significant defects noted.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Main walls	
Repair category:	1
Notes:	No significant defects noted.

Windows, external doors and joinery	
Repair category:	1
Notes:	No significant defects noted.

External decorations	
Repair category:	1
Notes:	No significant defects noted.

Conservatories / porches	
Repair category:	
Notes:	Not applicable.

Communal areas	
Repair category:	2
Notes:	There is some weathering and rot to fencing. There are some large mature trees within close proximity of the building. Whilst no associated damage was noted, tree root growth can cause disruption and damage to surfaces and structures below ground. These should be monitored.

Garages and permanent outbuildings	
Repair category:	
Notes:	Not applicable.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Outside areas and boundaries	
Repair category:	
Notes:	See 'Communal Areas' .

Ceilings	
Repair category:	1
Notes:	No significant defects noted.

Internal walls	
Repair category:	1
Notes:	No significant defects noted.

Floors including sub-floors	
Repair category:	1
Notes:	No significant defects noted.

Internal joinery and kitchen fittings	
Repair category:	2
Notes:	There is a cracked mirrored wardrobe door. There is some wear and tear to kitchen fittings.

Chimney breasts and fireplaces	
Repair category:	
Notes:	Not applicable.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Internal decorations	
Repair category:	1
Notes:	No significant defects noted.

Cellars	
Repair category:	
Notes:	Not applicable.

Electricity	
Repair category:	2
Notes:	No significant defects noted, however, the electrics have not been tested during our inspection. We have seen sight of an Electrical Installation Condition Certificate and this has been attached as an additional document to this Home Report. Please see the recommendations.

Gas	
Repair category:	1
Notes:	Although not specifically tested, no visual defects were identified. We have been given a copy of the recent Gas Safety Record dated 4th February 2024, a copy of which are attached.

Water, plumbing and bathroom fittings	
Repair category:	1
Notes:	There is some oxidation to pipework.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Heating and hot water

Repair category:

1

Notes:

No significant defects noted.

Gas fired central heating systems should be serviced on an annual basis by a Gas Safe registered engineer to ensure they run safely and efficiently.

Drainage

Repair category:

1

Notes:

No significant defects noted.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	
Roofing including roof space	1
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	1
External decorations	1
Conservatories / porches	
Communal areas	2
Garages and permanent outbuildings	
Outside areas and boundaries	
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	
Internal decorations	1
Cellars	
Electricity	2
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coinoperated machines.

1. Which floor(s) is the living accommodation on?	Ground Floor.
2. Are there three steps or fewer to a main entrance door of the property?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
3. Is there a lift to the main entrance door of the property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
4. Are all door openings greater than 750mm?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
5. Is there a toilet on the same level as the living room and kitchen?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
6. Is there a toilet on the same level as a bedroom?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
7. Are all rooms on the same level with no internal steps or stairs?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer	
<p>Absolute Ownership assumed. We are unaware of any easements, servitudes or rights of way which may adversely affect the property. This point should be confirmed by reference to the Title Deeds.</p> <p>We are unaware of any adverse planning proposals affecting the subjects although this should be confirmed by obtaining a Property Enquiry Certificate.</p> <p>It has been assumed that maintenance liability for the building is covered on an equitable basis with the other properties in the block.</p> <p>There appears to be a right of access over the grounds of the subjects for a neighbouring property.</p> <p>Normal maintenance is not treated as a repair for the purposes of the Single Survey. When a category 1 rating is provided this means the property must continue to be maintained in the normal way.</p> <p>Where items of maintenance or repair have been identified, the purchaser, should, prior to purchase, satisfy themselves as to the costs and implications of these issues.</p> <p>The proximity of commercial property to the subjects may pose a barrier for lending with certain mortgage providers. You should confirm that the property will form suitable security with your lender prior to submitting an offer to purchase.</p>	
Estimated re-instatement cost (£) for insurance purposes	
<p>£165,000 (One Hundred and Sixty-Five Thousand Pounds)</p> <p>We are of the opinion that the subjects should be insured for buildings reinstatement purposes for a sum of not less than the above noted figure. Building costs are currently increasing significantly above inflation due to material and labour shortages. It is recommended that you update this figure regularly to ensure that you have adequate cover or alternatively seek specialist advice from your insurer.</p>	
Valuation (£) and market comments	
<p>£145,000 (One Hundred and Forty-Five Thousand Pounds)</p> <p>The property is considered to be a reasonable purchase at or around the above noted valuation based on those matters covered within this report.</p> <p>Our valuation reflects current market conditions relating to this area. We would assume that current trends will prevail at the ultimate date of disposal with no adverse or onerous matters being introduced into the market during the intervening period which would have a detrimental effect on price.</p>	
Report author:	Graham Laird, BSc (Hons) MRICS
Company name:	Inverness - Allied Surveyors Scotland Ltd

Address:	Pavilion1 Fairways Business Park Inverness IV2 6AA
Signed:	Electronically Signed: 268594-328c9da1-c3fb
Date of report:	13/09/2024

PART 2.

MORTGAGE VALUATION REPORT

Includes a market valuation of the property.





Mortgage Valuation Report

Property:	1 Ben Wyvis View Barn Church Road Culloden Inverness IV2 7WB	Client: Mr. Andrew Davidson Tenure: Absolute Ownership.
Date of Inspection:	11/09/2024	Reference: I/24/09/029/GL

This report has been prepared as part of the seller's instructions to carry out a Single Survey on the property referred to above. The purpose of this report is to summarise the Single Survey for the purpose of advising a potential lender on the suitability of the property for mortgage purposes. The decision as to whether mortgage finance will be provided is entirely a matter for the lender. You should not rely on this report in making your decision to purchase but consider all the documents provided in the Home Report. Your attention is drawn to the additional comments elsewhere within the report which set out the extent and limitations of the service provided. This report should be read in conjunction with the Single Survey Terms and Conditions (with MVR). In accordance with RICS Valuation – Global Standards 2017 this report is for the use of the party to whom it is addressed or their named client or their nominated lender. No responsibility is accepted to any third party for the whole or any part of the reports contents. Neither the whole or any part of this report may be included in any document, circular or statement without prior approval in writing from the surveyor.

1.0 LOCATION

The property is located between a Chinese Takeaway and Community Centre, on the outskirts of the Smithton district of the city of Inverness. A wide range of amenities and facilities are available in close proximity.

2.0 DESCRIPTION **2.1 Age:** Built circa 2008.

The subjects comprise a two bedroom ground floor flat in a two-storey block of four units.

3.0 CONSTRUCTION

The walls are of timber frame and block construction.
The roof is pitched and tiled.
Floors are of suspended timber construction.

4.0 ACCOMMODATION

The accommodation may be summarised as follows:

Entrance Hallway, Lounge, Kitchen, Bathroom, Master Bedroom with En-Suite and One Further Bedroom.

5.0 SERVICES (No tests have been applied to any of the services)

Water:	Mains.	Electricity:	Mains.	Gas:	Mains.	Drainage:	Mains.
Central Heating:	Gas Fired Boiler to Radiators.						

6.0 OUTBUILDINGS

Garage:	None.
Others:	None.

7.0	GENERAL CONDITION - <i>A building survey has not been carried out, nor has any inspection been made of any woodwork, services or other parts of the property which were covered, unexposed or inaccessible. The report cannot therefore confirm that such parts of the property are free from defect. Failure to rectify defects, particularly involving water penetration may result in further and more serious defects arising. Where defects exist and where remedial work is necessary, prospective purchasers are advised to seek accurate estimates and costings from appropriate Contractors or Specialists before proceeding with the purchase. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site contamination.</i>				
The flat has been maintained in a good state of repair for one of its age, type and construction both internally and externally.					
8.0	ESSENTIAL REPAIR WORK <i>(as a condition of any mortgage or, to preserve the condition of the property)</i>				
None.					
8.1 Retention recommended:			N/A		
9.0	ROADS & FOOTPATHS				
Made up and adopted.					
10.0	BUILDINGS INSURANCE (£):	165,000	GROSS EXTERNAL FLOOR AREA	69	Square metres
<i>This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised.</i>					
11.0	GENERAL REMARKS				
<p>Absolute Ownership assumed. We are unaware of any easements, servitudes or rights of way which may adversely affect the property. This point should be confirmed by reference to the Title Deeds.</p> <p>We are unaware of any adverse planning proposals affecting the subjects although this should be confirmed by obtaining a Property Enquiry Certificate.</p> <p>It has been assumed that maintenance liability for the building is covered on an equitable basis with the other properties in the block.</p> <p>There appears to be a right of access over the grounds of the subjects for a neighbouring property.</p> <p>Normal maintenance is not treated as a repair for the purposes of the Single Survey. When a category 1 rating is provided this means the property must continue to be maintained in the normal way.</p> <p>Where items of maintenance or repair have been identified, the purchaser, should, prior to purchase, satisfy themselves as to the costs and implications of these issues.</p> <p>The proximity of commercial property to the subjects may pose a barrier for lending with certain mortgage providers. You should confirm that the property will form suitable security with your lender prior to submitting an offer to purchase.</p>					
12.0	VALUATION <i>On the assumption of vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights. It is assumed that all necessary Local Authority consents, which may have been required, have been sought and obtained. No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask for a specialist to undertake appropriate tests.</i>				
12.1	Market Value in present condition (£):	145,000	One Hundred and Forty-Five Thousand Pounds.		

12.2	Market Value on completion of essential works (£):	N/A	N/A	
12.3	Suitable security for normal mortgage purposes?	Yes		
12.4	Date of Valuation:	11/09/2024		
Signature:		Electronically Signed: 268594-328c9da1-c3fb		
Surveyor:	Graham Laird	BSc (Hons) MRICS	Date:	13/09/2024
Inverness - Allied Surveyors Scotland Ltd				
Office:	Pavilion1 Fairways Business Park Inverness IV2 6AA	Tel: 01463 239 494 Fax: email: inverness@alliedsurveyorsscotland.com		

PART 3.

ENERGY REPORT

A report on the energy efficiency of the property.



energy report

energy report on:

Property address	1 Ben Wyvis View Barn Church Road Culloden Inverness IV2 7WB
-------------------------	--

Customer	Mr. Andrew Davidson
-----------------	---------------------

Customer address	1 Ben Wyvis View Barn Church Road Culloden Inverness IV2 7WB
-------------------------	--

Prepared by	Graham Laird, BSc (Hons) MRICS Inverness - Allied Surveyors Scotland Ltd
--------------------	---

Energy Performance Certificate (EPC)

Scotland

Dwellings

1 BEN WYVIS VIEW, BARN CHURCH ROAD, CULLODEN, INVERNESS, IV2 7WB

Dwelling type: Ground-floor flat
Date of assessment: 11 September 2024
Date of certificate: 13 September 2024
Total floor area: 60 m²
Primary Energy Indicator: 139 kWh/m²/year

Reference number: 0140-2569-4010-2694-1551
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, mains gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly

Estimated energy costs for your home for 3 years*

£1,974

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions




Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band C (80)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

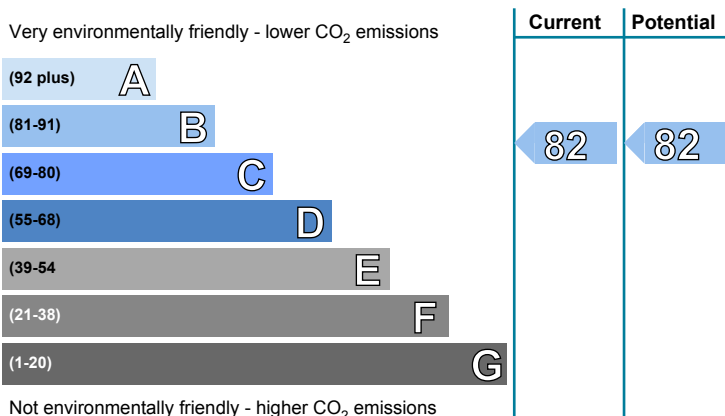

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band B (82)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

There are currently no improvement measures recommended for your home.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Timber frame, as built, insulated (assumed)	★★★★★	★★★★★
Roof	(another dwelling above)	—	—
Floor	Suspended, insulated (assumed)	—	—
Windows	Fully double glazed	★★★★☆	★★★★☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★☆
Secondary heating	None	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Low energy lighting in all fixed outlets	★★★★★	★★★★★

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 24 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 1.5 tonnes of carbon dioxide every year. You could reduce emissions by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£1,194 over 3 years	£1,194 over 3 years	Not applicable
Hot water	£522 over 3 years	£522 over 3 years	
Lighting	£258 over 3 years	£258 over 3 years	
Totals	£1,974	£1,974	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

None

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	2,770	N/A	N/A	N/A
Water heating (kWh per year)	1,859			

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Graham Laird
Assessor membership number:	EES/015039
Company name/trading name:	Allied Surveyors Scotland Ltd
Address:	Lyle House, Pavilion 1 Fairways Business Park Invernesshire Inverness IV2 6AA
Phone number:	01463 239 494
Email address:	inverness@alliedsurveyorsscotland.com
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

P A R T 4 .

PROPERTY QUESTIONNAIRE

The owner of the property is required to complete this document which asks for information on the property such as 'Which council tax band?' etc.



Property Questionnaire

Property Address

1 Ben Wyvis View
 Barn Church Road
 Inverness
 IV2 7WB

Seller(s)

Andrew Davidson

Completion date of property questionnaire

Note for sellers

1. Length of ownership
<p>How long have you owned the property?</p> <p>13 years</p>
2. Council tax
<p>Which Council Tax band is your property in? (Please circle)</p> <p><input type="checkbox"/> A <input type="checkbox"/> B <input checked="" type="checkbox"/> C <input type="checkbox"/> D <input type="checkbox"/> E <input type="checkbox"/> F <input type="checkbox"/> G <input type="checkbox"/> H</p>
3. Parking
<p>What are the arrangements for parking at your property?</p> <p>(Please tick all that apply)</p> <p>Garage <input type="checkbox"/></p> <p>Allocated parking space <input type="checkbox"/></p> <p>Driveway <input type="checkbox"/></p> <p>Shared parking <input checked="" type="checkbox"/></p> <p>On street <input type="checkbox"/></p> <p>Resident permit <input type="checkbox"/></p> <p>Metered parking <input type="checkbox"/></p> <p>Other (please specify):</p>

property questionnaire

4.	Conservation area	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
6.	Alterations/additions/extensions	
a	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please describe below the changes which you have made:	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
b	Have you had replacement windows, doors, patio doors or double glazing installed in your property	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	(ii) Did this work involve any changes to the window or door openings?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed): Please give any guarantees which you received for this work to your solicitor or estate agent.	
7.	Central heating	
a	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> Partial

property questionnaire

	If you have answered yes or partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air). <i>gas fired combi boiler</i>	
	If you have answered yes, please answer the three questions below:	
	(i) When was your central heating system or partial central heating system installed? <i>2008</i>	
	(ii) Do you have a maintenance contract for the central heating system?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please give details of the company with which you have a maintenance contract	
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year).	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
9.	Issues that may have affected your property	
a	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	<input type="checkbox"/> YES <input type="checkbox"/> NO
b	Are you aware of the existence of asbestos in your property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
	If you have answered yes, please give details:	
10.	Services	

a	Please tick which services are connected to your property and give details of the supplier:		
	Services	Connected	Supplier
	Gas or liquid petroleum gas	Y	Octopus Energy (I think)
	Water mains or private water supply	N	
	Electricity	Y	Octopus Energy (I think)
	Mains drainage	Y	Don't Know
	Telephone	N	
	Broadband	N	
b	Is there a septic tank system at your property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO	
	If you have answered yes, please answer the two questions below:		
	(i) Do you have appropriate consents for the discharge from your septic tank?	<input type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> Don't know	
	(ii) Do you have a maintenance contract for your septic tank?	<input type="checkbox"/> YES <input type="checkbox"/> NO	
	If you have answered yes, please give details of the company with which you have a maintenance contract:		
11. Responsibilities for shared or common areas			
a	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details: <i>The block of flats has 4 properties under one common roof. Whilst there is no formal agreement between residents, I am certain there is a duty for all residents to pay for maintenance works.</i>	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> Don't know	
b	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details: <i>see above</i>	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> N/A	
c	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO	
d	Do you have the right to walk over any of your neighbours' property- for example to put out your rubbish bin or to maintain your boundaries? If you have answered yes, please give details:	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO	

property questionnaire

e	<p>As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</p> <p>If you have answered yes, please give details:</p> <p><i>The Chinese take-away adjacent to the property has the right to enter the property and deliver goods via their backdoor goods entrance.</i></p>	[x]YES []NO
f	<p>As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately owned.)</p> <p>If you have answered yes, please give details:</p>	[]YES [x]NO
12. Charges associated with your property		
a	<p>Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:</p>	[]YES [x]NO
b	<p>Is there a common buildings insurance policy?</p>	[]YES [x]NO []Don't know
	<p>If you have answered yes, is the cost of the insurance included in your monthly/annual factors charges?</p>	
c	<p>Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.</p>	
13. Specialist works		
a	<p>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?</p>	[]YES [x]NO
	<p>If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.</p>	
b	<p>As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?</p>	[]YES [x]NO
	<p>If you have answered yes, please give details:</p>	
c	<p>If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?</p>	[]YES []NO
	<p>If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:</p>	

property questionnaire

14. Guarantees		
a	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	<input type="checkbox"/> NO <input type="checkbox"/> YES <input checked="" type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(ii)	Roofing	<input type="checkbox"/> NO <input type="checkbox"/> YES <input checked="" type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(iii)	Central heating	<input type="checkbox"/> NO <input type="checkbox"/> YES <input checked="" type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(iv)	National House Building Council(NHBC)	<input type="checkbox"/> NO <input type="checkbox"/> YES <input checked="" type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(v)	Damp course	<input type="checkbox"/> NO <input type="checkbox"/> YES <input checked="" type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	<input type="checkbox"/> NO <input type="checkbox"/> YES <input checked="" type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
b	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):	
c	Are there any outstanding claims under any of the guarantees listed above?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please give details:	

15. Boundaries		
	So far as you are aware, has any boundary of your property been moved in the last 10 years?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
	If you have answered yes, please give details:	
16. Notices that affect your property		
In the past three years have you ever received a notice:		
a	advising that the owner of a neighbouring property has made a planning application?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
b	that affects your property in some other way?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
c	that requires you to do any maintenance, repairs or improvements to your property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

Declaration by the seller(s)/or other authorised body or person(s) I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s):	Andrew Davidson
Capacity:	<input checked="" type="checkbox"/> Owner <input type="checkbox"/> Legally Appointed Agent for Owner
Date:	05/09/2024

SELECT
MEMBERSHIP
NUMBER
42027

This certificate is not valid if
number is defaced or altered

EICR: 280726

Copyright © The Electrical Contractors' Association Of Scotland

SECTION A. DETAILS OF THE CLIENT / PERSON ORDERING THE REPORT

Name: Mr A Davidson
Address: 1 Ben Wyvis View Barn Church Road Culloden Inverness IV2 7WB

SECTION B. REASON FOR PRODUCING THIS REPORT

Reason: Landlord's periodic maintenance

Date(s) on which inspection and testing was carried out: 05/10/2021

SECTION C. DETAILS OF THE INSTALLATION WHICH IS THE SUBJECT OF THIS REPORT

Occupier: Rented
Address: 1 Ben Wyvis View Church Road Culloden Inverness IV2 7WB
Description of premises (Tick as appropriate): Domestic Commercial Industrial Other
Estimated age of the wiring system 10 years. Evidence of additions or alterations Yes No Not apparent
If "Yes" estimate age 5 years. Installation records available? (Regulation 651.1) Yes No Date of last inspection

SECTION D. EXTENT AND LIMITATIONS OF INSPECTION AND TESTING

Extent of the electrical installation covered by this report:
Fixed wiring. Approximately 20% of accessories internally inspected. Supplier's main fuse seal not broken to verify fuse size.

Agreed limitations including the reasons (see Regulation 653.2):

Agreed with (name):

Operational limitations including the reasons: Appliances tested at switches as some are integrated.

The inspection and testing detailed in this report and accompanying schedules have been carried out in accordance with BS 7671: 2018 (IET Wiring Regulations), as amended to 01/07/2018. It should be noted that cables concealed within trunking and conduits, under floors, in roof spaces, and generally within the fabric of the building or underground, have not been inspected unless specifically agreed between the client and inspector prior to the inspection. An inspection should be made within an accessible roof space housing other electrical equipment.

SECTION E. SUMMARY OF THE CONDITION OF THE INSTALLATION

General condition of the installation (in terms of electrical safety):
Satisfactory for its age

Overall assessment of the installation in terms of its suitability for continued use
SATISFACTORY

*An unsatisfactory assessment indicates that dangerous (code C1) and/or potentially dangerous (code C2) conditions have been identified.

SECTION F. RECOMMENDATIONS

Where the overall assessment of the suitability of the installation for continued use above is stated as UNSATISFACTORY, I/we recommend that any observations classified as 'Danger present' (code C1) or 'Potentially dangerous' (code C2) are acted upon as a matter of urgency. Investigation without delay is recommended for observations identified as 'Further investigation required' (code F1).
Observations classified as 'Improvement recommended' (code C3) should be given due consideration.
Subject to the necessary remedial action being taken, I/we recommend that the installation is further inspected and tested by 05/10/2026 (date)

SECTION G. DECLARATION

I/We, being the person(s) responsible for the inspection and testing of the electrical installation (as indicated by my/our signatures below), particulars of which are described above, having exercised reasonable skill and care when carrying out the inspection and testing, hereby declare that the information in this report, including the observations and the attached schedules, provides an accurate assessment of the condition of the electrical installation taking into account the stated extent and limitations in section D of this report.

Inspected and tested by:

Name (Capitals): LIZZIE PORTER

Signature: 

For/on behalf of: Parker Technical Services Ltd

Position: Approved Electrician

Address: 9 Carsegate Road North Inverness Highland IV3 8DU

Date: 05/10/2021

Report authorised for issue by:

Name (Capitals): LIZZIE PORTER

Signature: 

For/on behalf of: Parker Technical Services Ltd

Position: Approved Electrician

Address: 9 Carsegate Road North Inverness Highland IV3 8DU

Date: 19/10/2021

SECTION H. SCHEDULE(S)

1 schedule(s) of inspection and 1 schedule(s) of test results are attached

The attached schedule(s) are part of this document and this report is valid only when they are attached to it.

ELECTRICAL INSTALLATION CONDITION REPORT

GUIDANCE FOR RECIPIENTS

This Report is an important and valuable document which should be retained for future reference.

1. The purpose of this Report is to confirm, so far as reasonably practicable, whether or not the electrical installation is in a satisfactory condition for continued service (see Section E). The Report should identify any damage, deterioration, defects and/or conditions which may give rise to danger (see Section K).
2. The person ordering the Report should have received the 'original' Report and the inspector should have retained a duplicate.
3. The 'original' Report should be retained in a safe place and be made available to any person inspecting or undertaking work on the electrical installation in the future. If the property is vacated, this Report will provide the new owner/occupier with details of the condition of the electrical installation at the time the Report was issued.
4. Where the installation incorporates a residual current device (RCD) there should be a notice at or near the device stating that it should be tested six-monthly. **For safety reasons it is important that this instruction is followed.**
5. Section D (Extent and Limitations) should identify fully the extent of the installation covered by this Report and any limitations on the inspection and testing. The inspector should have agreed these aspects with the person ordering the Report and with other interested parties (licensing authority, insurance company, mortgage provider and the like) before the inspection was carried out.
6. Some operational limitations, such as inability to gain access to parts of the installation or an item of equipment, may have been encountered during the inspection. The inspector should have noted these in Section D.
7. For items classified in Section K as C1 ('Danger present'), **the safety of those using the installation is at risk** and it is recommended that one or more skilled persons competent in electrical installation work undertake the necessary remedial work immediately.
8. For items classified in Section K as C2 ('Potentially dangerous'), **the safety of those using the installation may be at risk** and it is recommended that one or more skilled persons competent in electrical installation work undertake the necessary remedial work as a matter of urgency.
9. Where it has been stated in Section K that an observation requires further investigation (code FI) the inspection has revealed an apparent deficiency which may result in a code C1 or C2, and could not, due to the extent or limitations of the inspection, be fully identified. Such observations should be investigated without delay. A further examination of the installation will be necessary, to determine the nature and extent of the apparent deficiency (see Section F).
10. For safety reasons, the electrical installation should be re-inspected at appropriate intervals by one or more skilled persons competent in such work. The recommended date by which the next inspection is due is stated in Section F of the Report under 'Recommendations' and on a label at or near to the consumer unit / distribution board.

The personal data entered on this form is gathered because it is necessary in order to allow the discharging of a contract, and to support the legitimate business interests of the contractor. If you would like to know more about your personal data rights under GDPR, please ask your contractor for more information, or visit www.ico.org.uk.

SECTION I. SUPPLY CHARACTERISTICS AND EARTHING ARRANGEMENTS				
Earthing arrangements	Number and Type of Live Conductors		Nature of Supply Parameters	Supply Protective Device Characteristics
TN-C <input type="checkbox"/>	a.c. <input checked="" type="checkbox"/>	d.c. <input type="checkbox"/>	Nominal voltage, U / Uo ⁽¹⁾ 230 V	BS (EN): BS 1361
TN-S <input type="checkbox"/>	1-phase, 2-wire <input checked="" type="checkbox"/>	2-wire <input type="checkbox"/>	Nominal Frequency, f ⁽¹⁾ 50 Hz	Type: IIb
TN-C-S <input checked="" type="checkbox"/>	2-phase, 3-wire <input type="checkbox"/>	3-wire <input type="checkbox"/>	Prospective fault current, I _{pf} ⁽²⁾ 1.33 kA	Rated current: N/A A
TT <input type="checkbox"/>	3-phase, 3-wire <input type="checkbox"/>	Other <input type="checkbox"/>	External loop impedance, Z _e ⁽²⁾ 0.17 Ω	
IT <input type="checkbox"/>	3-phase, 4-wire <input type="checkbox"/>		(Note (1) by enquiry (2) by enquiry or by measurement)	
Confirmation of supply polarity <input checked="" type="checkbox"/>				

Other sources of supply (as detailed on attached schedule)

SECTION J. PARTICULARS OF INSTALLATION REFERRED TO IN THE REPORT

Means of Earthing	Details of Installation Earth Electrode (where applicable)			
Distributor's Facility <input checked="" type="checkbox"/>	Type (eg rod(s), tape etc) N/A			
Installation earth electrode <input type="checkbox"/>	Location: N/A			
	Electrode resistance to earth: N/A Ω			
Main Protective Conductors				
Earthing conductor:	Material: Copper	csa: 10	mm ²	Connection/continuity verified: <input checked="" type="checkbox"/>
Main protective bonding conductor (to extraneous-conductive-parts):	Material: Copper	csa: 10	mm ²	Connection/continuity verified: <input checked="" type="checkbox"/>
To water installation pipes <input checked="" type="checkbox"/>	To gas installation pipes <input checked="" type="checkbox"/>	To oil installation pipes <input type="checkbox"/>	To structural steel <input type="checkbox"/>	
To lightning protection <input type="checkbox"/>	To other <input type="checkbox"/> Specify:			
Main Switch / Switch-Fuse / Circuit-Breaker / RCD				
Location: Hall Cupboard	Current rating: 100	A	If RCD main switch	
BS(EN): EN 60947-3	Fuse / device rating or setting: A		Rated residual operating current (I _{Δn}):	N/A mA
No of poles: 2	Voltage rating: 230	V	Rated time delay:	N/A ms
			Measured operating time(at I _{Δn}):	N/A ms

SECTION K. OBSERVATIONS

Referring to the attached Schedules of Inspection and Test Results, and subject to the limitations specified at Section D, Extent and Limitations of the Inspection and Testing: No remedial action is required The following observations are made

Inspection Schedule Item No. or 'Test'	OBSERVATION(S)	Classification Code C1, C2, C3 or FI (see below)
1	Not all circuits have RCD Protection	C3
2	The fuse board is not to current regulations as it is plastic	C3
3	Only 1 no. socket circuit for whole property	Obs.
4	The gas main earth bond is at the boiler rather than within 600mm where it enters property	Obs.
5	The boiler is on the socket circuit	Obs.

One of the adjacent Codes, as appropriate, has been allocated to each of the observations made above to indicate to the person(s) responsible for the installation the degree of urgency for remedial action.	Danger present. Risk of injury. Immediate action required	C1
	Potentially dangerous - urgent remedial action required	C2
	Improvement recommended	C3
	Further investigation required without delay	FI

Additional observations are recorded on the following number of continuation sheet(s)

OUTCOMES	Acceptable condition	✓	Unacceptable condition	State C1 or C2	Improvement recommended	State C3	Further investigation	FI	Not verified	N/V	Limitation	LIM	Not applicable	N/A
ITEM NO.	DESCRIPTION												OUTCOME	
														Use codes above. Provide additional comment where appropriate. C1, C2, C3 and FI coded items to be recorded in Section K of the Condition Report
1.0	EXTERNAL CONDITION OF INTAKE EQUIPMENT (VISUAL INSPECTION ONLY)													
1.1	Service cable												✓	
1.2	Service head												✓	
1.3	Earthing arrangement												✓	
1.4	Meter tails												✓	
1.5	Metering equipment												✓	
1.6	Isolator (where present)												✓	
2.0	PRESENCE OF ADEQUATE ARRANGEMENTS FOR OTHER SOURCES SUCH AS MICROGENERATORS (551.6;551.7)													
3.0	EARTHING / BONDING ARRANGEMENTS (411.3; Chapter 54)													
3.1	Presence and condition of distributor's earthing arrangement (542.1.2.1; 542.1.2.2)												✓	
3.2	Presence and condition of earth electrode connection where applicable (542.1.2.3; 542.2)												N/A	
3.3	Provision of earthing/bonding labels at all appropriate locations (514.13)												✓	
3.4	Presence, condition & accessibility of earthing conductor at main earthing terminal(542.3;543.3.2)												✓	
3.5	Confirmation of earthing conductor size (542.3; 543.1.1)												✓	
3.6	Presence, condition & accessibility of main protective bonding conductors & connections(543.3.2; 544.1)												✓	
3.7	Confirmation of main protective conductor sizes (544.1)												✓	
3.8	Presence, condition & accessibility of other protective bonding conductors & connections (543.3.1; 543.3.2)												✓	
4.0	CONSUMER UNIT(S) / DISTRIBUTION BOARD(S)													
4.1	Adequacy of working space/accessibility to consumer unit/distribution board (132.12; 513.1)												✓	
4.2	Security of fixing (134.1.1)												✓	
4.3	Condition of enclosure(s) in terms of IP rating (416.2)												✓	
4.4	Condition of enclosure(s) in terms of fire rating etc (421.1.201; 421.1.6; 526.5)												C3	
4.5	Enclosure not damaged/deteriorated so as to impair safety (621.2)												✓	
4.6	Presence of main linked switch (as required by 462.1.201)												✓	
4.7	Operation of main switch (functional check) (643.10)												✓	
4.8	Manual operation of circuit-breakers and RCDs to prove disconnection (643.10)												✓	
4.9	Correct identification of circuit details and protective devices (514.8; 514.9)												✓	
4.10	Presence of RCD six-monthly test notice at or near consumer unit/distribution board (514.12.2)												✓	
4.11	Presence of non-standard (mixed) cable colour warning notice at or near consumer unit/distribution board (514.14)												N/A	
4.12	Presence of alternative supply warning notice at or near consumer unit/distribution board (514.15)												N/A	
4.13	Presence of other required labelling (please specify) (Section 514)												N/A	
4.14	Compatibility of protective device(s) and base(s); correct type and rating (no signs of unacceptable thermal damage, arcing or overheating) (421.1.3)												✓	
4.15	Single-pole switching or protective devices in line conductors only (132.14.1; 530.3.3)												✓	
4.16	Protection against mechanical damage where cables enter consumer unit/distribution board (522.8.1; 522.8.5; 522.8.11)												✓	
4.17	Protection against electromagnetic effects where cables enter consumer unit/distribution board/enclosures (521.5)												N/A	
4.18	RCD(s) provided for fault protection - includes RCBOs (411.4.204; 411.5; 531.3)												✓	
4.19	RCD(s) provided for additional protection/requirements - includes RCBOs (415.1) see item 5.12												C3	
4.20	Confirmation of indication that SPD is functional (651.4)												N/A	
4.21	Confirmation that ALL conductor connections, including connections to busbars, are correctly located in terminals and are tight and secure (526.1)												✓	
4.22	Adequate arrangements where a generating set operates as a switched alternative to the public supply (551.6)												N/A	
4.23	Adequate arrangements where a generating set operates in parallel with the public supply (551.7)												N/A	

OUTCOMES	Acceptable condition	✓	Unacceptable condition	State C1 or C2	Improvement recommended	State C3	Further investigation	FI	Not verified	N/V	Limitation	LIM	Not applicable	N/A
ITEM NO.	DESCRIPTION												OUTCOME	
													Use codes above. Provide additional comment where appropriate. C1, C2, C3 and FI coded items to be recorded in Section K of the Condition Report	
5.0 DISTRIBUTION / FINAL CIRCUITS														
5.1	Identification of conductors (514)												✓	
5.2	Cables correctly supported throughout their run (521.10.202; 522.8.5)												LIM	
5.3	Condition of insulation of live parts (416.1)												✓	
5.4	Non-sheathed cables protected by enclosure in conduit, ducting or trunking (521.10.1; 526.8) To include the integrity of conduit and trunking systems (metallic and plastic)												N/A	
5.5	Adequacy of cables for current-carrying capacity with regard for the type and nature of installation (Section 523)												✓	
5.6	Coordination between conductors and overload protective devices (433.1; 533.2.1)												✓	
5.7	Adequacy of protective devices: type and rated current for fault protection (411.3)												✓	
5.8	Presence and adequacy of circuit protective conductors (411.3.1.1; Section 543)												✓	
5.9	Wiring system(s) appropriate for the type and nature of the installation and external influences (Section 522)												✓	
5.10	Concealed cables installed in prescribed zones (see Section D. <i>Extent and limitations</i>) (522.6.202)												LIM	
5.11	Cables concealed under floors, above ceilings or in walls/partitions, adequately protected against damage (see Section D. <i>Extent and limitations</i>) (522.6)												LIM	
5.12	Provision of additional requirements for protection by RCD not exceeding 30mA (415.1)													
	a) for all socket-outlets of rating 32 A or less, unless an exception is permitted (411.3.3)												✓	
	b) for supply of mobile equipment not exceeding 32 A rating for use outdoors (411.3.3)												✓	
	c) for cables concealed in walls at a depth of less than 50mm (522.6.202; 522.6.203)												C3	
	d) for cables concealed in walls/partitions containing metal parts regardless of depth (522.6.203)												N/A	
	e) for final circuits supplying luminaries with domestic (household) premises (411.3.4)												C3	
5.13	Provision of fire barriers, sealing arrangements and protection against thermal effects (Section 527)												LIM	
5.14	Band II cables segregated / separated from Band I cables (528.1)												LIM	
5.15	Cables segregated / separated from communications cabling (528.2)												LIM	
5.16	Cables segregated / separated from non-electrical services (528.3)												LIM	
5.17	Termination of cables at enclosures - indicate extent of sampling in Section D of the report													
	a) Connections soundly made and under no undue strain (526.6)												✓	
	b) No basic insulation of a conductor visible outside enclosure (526.8)												✓	
	c) Connections of live conductors adequately enclosed (526.5)												✓	
	d) Adequately connected at point of entry to enclosure (glands, bushes etc.) (522.8.5)												✓	
5.18	Condition of accessories including socket-outlets, switches and joint boxes (621.2(v))												✓	
5.19	Suitability of accessories for external influences (512.2)												✓	
5.20	Adequacy of working space/accessibility to equipment (132.12; 513.1)												✓	
5.21	Single-pole switching or protective devices in line conductors only (132.14.1; 530.3.2)												✓	
6.0 LOCATION(S) CONTAINING A BATH OR SHOWER (SECTION 701)														
6.1	Additional protection for all low voltage (LV) circuits by RCD not exceeding 30mA (701.411.3.3)												✓	
6.2	Where used as a protective measure, requirements for SELV or PELV met (701.414.4.5)												N/A	
6.3	Shaver sockets comply with BS EN 61558-2-5 formerly BS 3535 (701.512.3)												N/A	
6.4	Presence of supplementary bonding conductors, unless not required by BS 7671:2018 (701.415.2)												✓	
6.5	Low voltage (e.g. 230 volt) socket-outlets sited at least 3 m from zone 1 (701.512.3)												N/A	
6.6	Suitability of equipment for external influences for installed location in terms of IP rating (701.512.2)												✓	
6.7	Suitability of accessories and control gear etc. for a particular zone (701.512.3)												✓	
6.8	Suitability of current-using equipment for particular position within the location (701.55)												✓	
7.0 OTHER PART 7 SPECIAL INSTALLATIONS OR LOCATIONS														
7.1	List all other special installations or locations present, if any. (Record separately the results of particular inspections applied.)												N/A	



Details of circuits and/or installed equipment vulnerable to damage when testing

Zs at DB 0.17 (Ω)

NEON, LAMP, SMOKE DETECTORS, FUSES, RCD

Ip at DB 1.33 (kA)

DB Reference no:

DB Location & Type Hall Cupboard Crabtree Loadstar 12w

Phase sequence confirmed (where appropriate):

Correct supply polarity confirmed:

CIRCUIT DETAILS										TEST RESULTS												
No	Circuit Description	No of points	Wiring Details			Protective Device (lowest breaking capacity 6 kA)		Continuity			# Insulation Resistance (Lowest values measured)		Polarity	Zs (Max measured values) Ω	RCD Protection (500% test for RCDs rated at 30 mA or less only)			Functional tests of switch-gear etc. *	Remarks Indicate points of note e.g: •Additional outlets equipment supplied •Provision of AFDD for circuit •Reduced IR test voltage			
			Type (See code below)	Ref Method †	Conductor csa mm ²	Type	Amps	(R1 + R2) Ω	L-L	L-E	LAh	mA			Time (ms)	500%						
			Live	cpc	mm ²	R1	R2	L-L	L-E	LAh	mA	Time (ms)	500%									
1	Spare																					
2	Cooker	1	A	C	6	2.5	B	32	0.13		>299	>299		0.29								
3	Washing Machine	1	A	C	2.5	1.5	B	16	0.03		>299	>299		0.22								
4	Dishwasher	1	A	C	2.5	1.5	B	16	0.03		>299	>299		0.21								
5	Fridge/Freezer	1	A	C	2.5	1.5	B	16	0.03		>299	>299		0.23								
6	Hall/Liv/Kit Lts/Smokies	9	A	C	1	1	B	6	0.97		>299	>299		1.05								
7	Bath/Beds Lts/Smokies	9	A	C	1	1	B	6	0.85		>299	>299		0.79								
8	Spare																					
9	Spare																					
10	Sockets/Boiler	17	A	C	2.5	1.5	B	32	0.58	0.96	0.96	>299	>299	0.81	30	35.7	14.5					
11	Heat Matt	1	A	C	6	2.5	B	32	0.06		>299	>299		0.53	30	35.7	14.5					
12	Cupboard Sockets	2	A	C	6	2.5	B	32	0.06		>299	>299		0.32	30	35.7	14.5					

† Insert Reference Method (see Table 4A2 from BS 7671 Appendix 4)

#R test voltage 500 V DC unless stated in 'Remarks'

*Includes RCD and/or AFDD test button

TEST INSTRUMENTS USED									
Code for Wiring Type	A	B	C	D	E	F	G	H	O (Other - please specify)
PVC/PVC			PVC in Plastic Conduit	PVC in Metal Trunking	PVC in Plastic Trunking	PVC/SWA	XLPE/SWA	Mineral Insulated	
Manufacturer	Type	Serial No.	Date Accuracy Verified	Manufacturer	Type	Date Accuracy Verified	Manufacturer	Type	Serial No.
MEGGER	MFT1731	0195	05/08/2021						

LANDLORD / HOME OWNER GAS SAFETY RECORD

SERIAL NO
CP12 8809390



This form allows the recording of the results of the required checks as defined by the Gas Safety (Installation and Use) Regulations. Chimney systems were inspected visually and checked for satisfactory evacuation of products of combustion, a detailed internal inspection of the chimney system has not been carried out. The information recorded on this form does not confirm that the installation was installed by a person licensed by Gas Safe Register nor that the installation complies with any relevant Building Regulations. For appliances not owned by the Landlord, where only visual checks are undertaken, recording a YES in 'Appliance Safe' is based only on a visual check for obvious defects with no physical tests completed.

JOB ADDRESS Rented Accommodation (Yes / No) YES

LANDLORD DETAILS (or where appropriate their agent)

REGISTERED BUSINESS DETAILS

Name: ANITA DANON
 Address: 1 BEN WYVIS VIEW
BARN CHURCH ROAD, CANNON
LANWESSE
 Postcode: IV2 7JW
 Tel No: 07715 208644

Name: _____
 Address: _____
 Postcode: _____
 Tel No: _____

Reg No: 60601
 Company: ARIS SERVICES LTD
 Address: COLE LANE, LANWESSE
LANWESSE
 Postcode: IV2 3JP
 Tel No: 01473 214780

APPLIANCE DETAILS

Location	Appliance Type	Make	Model	Chimney/Flue Type (FLO/FRS)	Landlord's Appliance (Yes/No/NA)	Appliance Checked (Yes/No)
1 <u>KITCHEN</u>	<u>BOILER</u>	<u>Worcester</u>	<u>Worcester 3000</u>	<u>R5</u>	<u>YES</u>	<u>YES</u>
2 <u>KITCHEN</u>	<u>HOB</u>	<u>Candy</u>	<u>LA RING</u>	<u>R2</u>	<u>YES</u>	<u>YES</u>
3						
4						

INSPECTION / SAFETY CHECKS

CHIMNEY CHECKS

COMBUSTION READING(S)

SUMMARY

AUDIBLE CO DETECTOR

Ventilation Satisfactory (Yes/No)	Operating Pressure or Heat Input (mbar/kW)	Safety Device(s) Correct Operation (Yes/No)	Visual Condition Satisfactory (Yes/No/NA)	Chimney/Flue Performance (Pass/Fail/NA)	Initial (If Applicable)	Final (If Applicable)	Appliance Serviced (Yes/No)	Appliance Safe (Yes/No)	Correctly Installed (Yes/No/NA)	In Date (Yes/No/NA)	Test Satisfactory (Yes/No/NA)
1 <u>YES</u>	<u>Temp / 31.15 kW</u>	<u>YES</u>	<u>YES</u>	<u>Pass</u>	<u>00-9-1</u>	<u>0.0001</u>	<u>YES</u>	<u>YES</u>	<u>YES</u>	<u>YES</u>	<u>YES</u>
2 <u>YES</u>	<u>5.4 kW</u>	<u>YES</u>	<u>NA</u>	<u>NA</u>	<u>NA</u>	<u>NA</u>	<u>NO</u>	<u>YES</u>			
3											
4											

APPLIANCE DEFECT(S) IDENTIFIED

REMEDIAL ACTION TAKEN

INSTALLATION GENERAL (Yes/No/NA)

Emergency Control Valve Satisfactory: YES

Meter / Cylinder Installation Satisfactory (Visual): YES

Main Protective Bonding Satisfactory (Visual): YES

Gas Installation Pipework Satisfactory (Visual): YES

Gas Installation Correct Materials Used (Visual): YES

Gas Tightness Test Satisfactory: YES

DETAILS OF OTHER WORK CARRIED OUT (e.g. service etc.)

SERVICE

OBSERVATIONS / COMMENTS / REMEDIAL WORK REQUIRED

SAFETY CHECK DUE BEFORE

07/04/25

Issued by: _____

Print Name: Paul Barran

Licence No: 5492754

Signed:

Issue Date: 04/03/24

Received by: Keys

Print Name: _____

Signed: _____

Tenant / Home Owner / Landlord / Other (please state) _____

No one present at the time of visit

LANDLORD / HOME OWNER GAS SAFETY RECORD

SERIAL No
CP12 8809390



This form allows the recording of the results of the required checks as defined by the Gas Safety (Installation and Use) Regulations. Chimney systems were inspected visually and checked for satisfactory evacuation of products of combustion, a detailed internal inspection of the chimney system has not been carried out. The information recorded on this form does not confirm that the installation was installed by a person licensed by Gas Safe Register nor that the installation complies with any relevant Building Regulations. For appliances not owned by the Landlord, where only visual checks are undertaken, recording a YES in 'Appliance Safe' is based only on a visual check for obvious defects with no physical tests completed.

JOB ADDRESS Rented/Accommodation (Yes/No)

LANDLORD DETAILS (or where appropriate their agent)

REGISTERED BUSINESS DETAILS

Name: _____
 Address: _____
 Postcode: _____
 Tel No: _____

Name: _____
 Address: _____
 Postcode: _____
 Tel No: _____

Reg No: _____
 Company: _____
 Address: _____
 Postcode: _____
 Tel No: _____

APPLIANCE DETAILS

APPLIANCE DETAILS		No. of Appliances Listed Below:	
Location	Appliance Type	Make	Model
1	Gas Cooker	AGORA	AGORA 60
2	Gas Cooker	AGORA	AGORA 60
3	Gas Cooker	AGORA	AGORA 60
4			

INSPECTION / SAFETY CHECKS

CHIMNEY CHECKS

COMBUSTION READING(S)

SUMMARY

AUDIBLE CO DETECTOR

1	Operating Pressure or Heat Input (mbar/kW)	Safety Device(s) Correct Operation (Yes/No)	Visual Condition Satisfactory (Yes/No/NA)	Chimney/Flue Performance (Pass/Fail/NA)	Initial (If Applicable)	Final (If Applicable)	Appliance Serviced (Yes/No)	Appliance Safe (Yes/No)	Correctly Installed (Yes/No/NA)	In Date (Yes/No/NA)	Test Satisfactory (Yes/No/NA)
1	1.0	Yes	Yes	Pass			Yes	Yes	Yes	Yes	Yes
2	1.0	Yes	Yes	Pass			Yes	Yes	Yes	Yes	Yes
3	1.0	Yes	Yes	Pass			Yes	Yes	Yes	Yes	Yes
4											

APPLIANCE DEFECT(S) IDENTIFIED

REMEDIAL ACTION TAKEN

INSTALLATION GENERAL (Yes/No/NA)

Emergency Control Valve Satisfactory: Gas Installation Pipework Satisfactory (Visual):
 Meter / Cylinder Installation Satisfactory (Visual): Gas Installation Correct Materials Used (Visual):
 Main Protective Bonding Satisfactory (Visual): Gas Tightness Test Satisfactory:

DETAILS OF OTHER WORK CARRIED OUT (e.g. service, etc.)

OBSERVATIONS / COMMENTS / REMEDIAL WORK REQUIRED

SAFETY CHECK DUE BEFORE

NEXT

Print Name: _____ Signed: _____
 Licence No: _____ Issue Date: _____

Received by: _____
 Print Name: _____ Signed: _____

Tenant / Home Owner / Landlord / Other (please state) _____

No one present at the time of visit

To re-order quote Ref. CP12

Top Copy - Landlord / Managing Agent / Home Owner

Middle Copy - Tenant

Bottom Copy - Registered Business

WARNING NOTICE SERIAL No(s)

* Refer to separate Warning Notice(s)

Gas Safe Register is a registered trade mark of the HSE and is used under licence.